OHIO SCIENTIFIC INC.
TECH NEWSLETTER #6

65-U CD-23

THIS CHANGE CORRECTS A PROBLEM IN THE SEEK RETRY CODE. THE SYMPTON APPEARED AS INFREQUENT CYLINDER MISMATCH ERRORS.

OK RUN"CHANGE", "PASS

DISK CHANGE UTILITY

MODE: HEX(H), DED(D) ? H UNIT ? E ADDRESS OFFSET ? CØØ ADDRESS ? 362D

ØØØØ362D 9C ? 9E
ØØØØ362E 5 35 ? X

OK CLOSE

Sales Notes:

WE HAVE RUN INTO SEVERAL DEALERS WHO WERE NOT AWARE OF THE FACT THAT THE NEC PRINTER WILL CURRENTLY ONLY WORK WITH THE WP-2 WORD PROCESSOR. THE N.E.C. INTERFACE REQUIRES A SPECIAL SOFTWARE DRIVER AND THEREFORE WILL NOT WORK WITH OS-65U, OS-65D, AMCAP, OS-DMS, OR OS-CP/M, ETC. THOSE DEALERS WHO PURCHASED THE FIRST RELEASE OF WP-2 MAY RECEIVE UPDATES. IT HAS BEEN REQUESTED THAT YOU SEND A COPY OF THE INVOICE TO RECEIVE THE UPDATE. A \$10.00 SERVICE CHARGE WILL BE RENDERED TO COVER THE COST OF THE DISKETTE AND MANUAL. IT WILL BE UP TO YOU TO PROVIDE YOUR CUSTOMERS WITH UPDATES.

THE C2-8P S.F., C2-8S S.F. AND CD-IP MODELS ARE NO LONGER AVAILABLE.

THE C2-4P CASSETTE_BASED COLOR MODEL IS CURRENTLY NOT AVAILABLE. THERE IS A POSSIBILITY OF A FALL RELEASE.

WP-2 SECOND RELEASE ONLY (5/18/79)

THE FOLLOWING CORRECTS A PROBLEM WITH FINELY GRADUATED SPACING ON SERIAL WORD PROCESSING PRINTERS WITH THE "XTRA ON" FEATURE INVOKED.

- 1:) BOOT-UP WP-2
- 2) TYPE:

EXXX < CR>

3) NOW ENTER

RE M CR7

4) ENTER THE FOLLOWING:

L ØB2F 2F R L 1391 A4 R

L ØAØ1 3ØØ6 A522 38 R

L Ø12E 2547 R

5) a "A*" SHOULD APPEAR ON THE SCREEN

6) NOW ENTER:

S A V E \emptyset 5,1= \emptyset 2 \emptyset \emptyset /B < CR >

S A V E Ø6,1=ØDØØ/B4CR7

S A V E Ø7,1=1800/B CR>

HOW TO MAKE CHANGES TO WP-2

- BOOT WP-2
- TYPE "EXXX" 2.
- TYPE "RE M"
- MAKE CHANGES WITH MACHINE LANGUAGE MONITOR
- REENTER DOS AT \$2547
- SAVE REVISED WP-2 ON DISK BY TYPING:

SA Ø5,1= Ø2ØØ/B SA Ø6,1= ØDØØ/B SA Ø7,1= 18ØØ/B

OS-65U V1.0 - V1.1 ALL SYSTEMS

THIS CHANGE CORRECTS A PROBLEM WITH THE OCCASIONAL INDENTATION OF LISTED LINES AND TO PRINT Ø AS Ø.00 IN THE MONEY MODE.

RUN"CHANGE", "PASS

DISK CHANGE UTIEITY

MODE: HEX(H), DEC(D) ? H UNIT ? A ADDRESS OFFSET ? COO ADDRESS ? 20EC F8 ? F8 ØØØØ20EC 999929ED @ 69 ? . ADDRESS ? 1000 **ØØØØTDØØ** 85 ? 85 AA ? AA 00001001 99991 D92 A6 ? A6 AE ? AE 00001003 00001 D04 FØ ? FØ 00001005 ; 3B ? 3B EA ? EA **ØØØØ1** DØ6 99991D97 A9 ? X

(THIS COLUMN MAY DIFFER IN YOUR SYSTEM)

OK CLOSE

OK

OS-65U VI.1 LEVEL III ONLY

THIS CORRECTION DEALS WITH FILE CONTENTION UNDER OS-65U V1.1 LEVEL III. THE PROBLEM SHOWED UP AS VERY OCCASIONAL STRAY WRITES TO THE CD-74.

THE FOLLOWING BASIC PROGRAM LINES SHOULD BE ADDED TO THE LEVEL III PROGRAM.

- T) ENTER:
 LOAND "LEVEL3", "PASS CR
- 2)" ADD THE FOLLOWING LINES

 930 REM MOV CNTROL BLKS TO WITHIN PARTITIONS 5/79 R1*

 931 DATA 56993,160,34,57004,160,34

 932 REM CORRECT CYL NUMBER HANDLER 5/79 R1*

 933 DATA 56726,175,76,56813,175,76,56980,175,76
- 3) NOW ENTER:
 SAVE "LEVEL3", "PASS CR
- 4) THE FIX HAS NOW BEEN INSERTED.